




Home Report

shepherd.co.uk

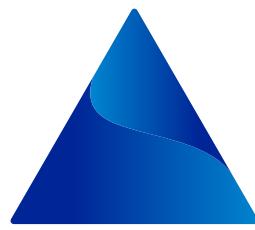

SHEPHERD
CHARTERED SURVEYORS

All Angles Covered

Residential | Commercial | Property & Construction



Contents

1. Scottish Single Survey
2. Energy Performance Certificate
3. Property Questionnaire



Scottish Single Survey



Single Survey

survey report on:

Property address	Ashton Tongland Kirkcudbright DG6 4LT
Customer	Miss Louisa Mansfield (Power of Attorney)
Customer address	Ashton Tongland Kirkcudbright DG6 4LT
Prepared by	Shepherd Chartered Surveyors
Date of inspection	08/05/2025



www.shepherd.co.uk

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by marking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

Terms and Conditions

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report².

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

Terms and Conditions

they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is *the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;

Terms and Conditions

- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments

Terms and Conditions

being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use

Terms and Conditions

communal grounds, parking areas, and other facilities;

- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

Single Survey

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	Two storey detached house.
--------------------	----------------------------

Accommodation	Ground Floor: Lounge, Sun Room, Dining Room, Study, Hallways, Rear Vestibule/Porch and Cloakroom with w.c.. First Floor: Bedroom 1, Bedroom 2, Bedroom 3, Bedroom 4, Bedroom 4, two Bathrooms with w.c. and Cloakroom with w.c.
----------------------	--

Gross internal floor area (m²)	303m ² or thereby.
--	-------------------------------

Neighbourhood and location	The property is situated in a rural local adjoining the A711, approximately 2 miles north of Kirkcudbright where the main shopping, social and educational amenities for the area are provided. There is a large electricity sub-station, associated with the nearby Tongland hydro-electric power station, immediately to the north of the property's garden, but this is more than 80 metres from the house.
-----------------------------------	---

Age	It is estimated that the property was constructed in the late 1800s.
------------	--

Weather	Dry and sunny.
----------------	----------------

Chimney stacks	Visually inspected with the aid of binoculars where appropriate. The chimneys are of brick rendered construction with clay pots.
-----------------------	--

Single Survey

Roofing including roof space	<p>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</p> <p>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</p> <p>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p> <p>The main roof is pitched and slated with tiled ridging. The roof has been designed with the rafters and other timbers projecting beyond the wallhead and being exposed externally.</p> <p>There is a mono-pitched slated roof over the rear porch/vestibule. It has a metal skylight, but this has been covered over internally.</p> <p>The roof over the two storey rear outshoot would appear to be laid in concrete tiles. However, this roof could not be viewed from ground level and from within the site boundaries.</p> <p>The flat roof over the sunroom has a fibreglass covering.</p> <p>Access into the main attic roof space is gained through a ceiling hatch in the northmost bedroom. Not all parts of the roof void were entered and inspected. The roof is of timber frame construction overlaid with sarkingboard, and there is an older type of felt membrane beneath the slates.</p> <p>A ceiling hatch in the ground floor cloakroom/toilet provides access into a void within the rear section of the building. The loft was not fully entered.</p> <p>The roof voids are insulated, but the insulation level falls short of current minimum recommended levels.</p>
-------------------------------------	---

Rainwater fittings	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>The rainwater fittings are formed in a mix of cast iron, PVC and aluminium.</p>
---------------------------	---

Single Survey

Main walls	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Foundations and concealed parts were not exposed or inspected.</p> <p>The main walls are of cavity brick construction which are rendered externally, and the extensions are of similar construction.</p>
Windows, external doors and joinery	<p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p> <p>The windows are mostly secondary glazed timber sash and case type, there are some single glazed timber framed windows and a few have sealed unit double glazing.</p> <p>The sun room has timber double glazed French doors and windows, and there is a timber glazed external door to the rear entrance.</p> <p>The facias, soffits and bargeboards are formed in timber.</p>
External decorations	Visually inspected.
Conservatories / porches	Not applicable.
Communal areas	Not applicable.
Garages and permanent outbuildings	<p>Visually inspected.</p> <p>There is a garage/workshop with a gross internal floor area of 69m² or thereby. This building is of timber frame construction. The roof is clad with metal profile sheeting. The infill walls are constructed of concrete block, and there is fibre cement cladding to some of the upper walls which is suspected to contain asbestos.</p> <p>Attached to the garage/workshop is a pre-existing outbuilding that is split into three compartments with a combined gross internal floor area of 32m² or thereby. The walls are of brick construction and the roof is slated.</p>

Single Survey

Outside areas and boundaries	<p>Visually inspected.</p> <p>The house sits within a large garden that is mostly enclosed with post and wire fencing, and a metal palisade security fence forms the boundary with the sub-station to the north. The driveway is laid in gravel.</p>
Ceilings	<p>Visually inspected from floor level.</p> <p>The ceilings are lined with a mix of timber lath and plaster and plasterboard.</p>
Internal walls	<p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p> <p>The main walls are plastered on the hard internally, and the partitions are a mix of solid construction and timber studs.</p>
Floors including sub floors	<p>The floors are a mix of concrete and suspended timber construction.</p> <p>It was not possible to inspect the floor surfaces due to the presence of fitted coverings in all rooms.</p>
Internal joinery and kitchen fittings	<p>Built-in cupboards were looked into but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p> <p>The internal doors are a mix of timber panelled and timber glazed types.</p> <p>There are non-matching fitted units in the kitchen which are dated/semi modern.</p> <p>A timber staircase with carpet runner provides access to the first floor landing from the hall.</p>
Chimney breasts and fireplaces	<p>Visually inspected.</p> <p>No testing of the flues or fittings was carried out.</p> <p>The lounge and dining room have fireplaces with open fires. Fireplaces remain within some of the bedrooms although these are not currently in use. There is an oil fired AGA in the kitchen.</p>

Single Survey

Internal decorations	Visually inspected.
Cellars	Visually inspected where there was a safe and purpose-built access. There is a cellar beneath the front section of the building that is accessed via stone stairs. The gross floor area extends to 25m ² or thereby.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Mains electricity. The electric meter is in the kitchen.
Gas	No gas supply.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances. Water is assumed to be from the mains supply. The fibreglass cold water storage tank is in the attic. The kitchen units are fitted with a stainless steel sink. The sanitary fittings are semi modern/dated and include a white wash hand basin and w.c. in the ground floor cloakroom, a white w.c. but no wash hand basin in the upstairs toilet, a four piece white suite in the bath/shower room and a three piece white suite in the second bathroom.

Single Survey

Heating and hot water	<p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>The floor-standing 'Trianco' oil fired boiler is in the rear hallway, within an extended part of the house. The boiler is assumed to provide domestic hot water, and it also heats radiators in the main rooms. The radiators are fitted with thermostatic valves and there is a room thermostat in the front hall. The foam insulated hot water tank, which is fitted with a thermostat, is in a cupboard adjoining the chimney breast in the kitchen.</p>
Drainage	<p>Drainage covers etc. were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p> <p>Drainage is understood to be connected to a septic tank that is located outwith the boundaries on the opposite side of the A711. For the avoidance of doubt the tank was not located or inspected to confirm its age, type and condition, and the drainage system has not been checked or tested in any way.</p>
Fire, smoke and burglar alarms	<p>Visually inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>All Scottish homes require a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also needs to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon-fuelled appliance such as a boiler, open fire or wood burner, a carbon monoxide detector is also required. We have not assessed or tested any existing equipment and it is the purchasers responsibility to confirm that the property will comply with these standards following a change of ownership.</p> <p>In the interests of security no comment is made in relation to the presence or otherwise of a burglar alarm.</p> <p>There appears to be smoke detection equipment in place and although not tested, this may not fully comply with Scottish Government guidelines on Fire and Smoke alarms, effective from February 2022. Further checks should be made and the system upgraded as necessary.</p>

Single Survey

Any additional limits to inspection	<p>The property was occupied at the time of the inspection, and the survey was restricted by floor coverings, furniture, stored articles and personal items. Those parts of the property concealed behind fitted units and sanitary fittings etc were not viewed. Only a limited and partial inspection of the roof voids as undertaken.</p> <p>Where timbers are affected by dampness due to the inherent nature of the construction, or have become wet as a result of existing or previous defects in the building fabric, or leaking plumbing etc, it is possible for decay to manifest itself within concealed areas and to only become apparent in the future. Hidden areas that were not accessed or inspected cannot be reported as being free from defect, and any comments regarding the condition of the property must be read in this context.</p> <p>The report does not include an Asbestos Inspection. However, asbestos was widely used in residential construction until it was finally banned 1999. If suspected asbestos containing material has been highlighted in this report, or if there are concerns of its potential existence having regard to the age of the property, a qualified asbestos surveyor should be engaged to carry out an inspection should further advice be required.</p> <p>The report is not a Fire Risk Assessment, and the surveyor is not qualified to provide specific advice on fire safety issues.</p> <p>An inspection for Japanese Knotweed was not carried out. This is a plant that is subject to control regulation, is considered to be invasive, and can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or on neighbouring ground. Identification of Japanese Knotweed is best undertaken by a specialist. If it exists, removal must be undertaken in a controlled manner by a specialist contractor, which can be expensive.</p>
--	--

Sectional Diagram showing elements of a typical house



- 1 Chimney pots
- 2 Coping stone
- 3 Chimney head
- 4 Flashing
- 5 Ridge ventilation
- 6 Ridge board
- 7 Slates / tiles
- 8 Valley guttering
- 9 Dormer projection
- 10 Dormer flashing
- 11 Dormer cheeks
- 12 Sarking
- 13 Roof felt
- 14 Trusses
- 15 Collar
- 16 Insulation
- 17 Parapet gutter
- 18 Eaves guttering
- 19 Rainwater downpipe
- 20 Verge boards /skews
- 21 Soffit boards
- 22 Partition wall
- 23 Lath / plaster
- 24 Chimney breast
- 25 Window pointing
- 26 Window sills
- 27 Rendering
- 28 Brickwork / pointing
- 29 Bay window projection
- 30 Lintels
- 31 Cavity walls / wall ties
- 32 Subfloor ventilator
- 33 Damp proof course
- 34 Base course
- 35 Foundations
- 36 Solum
- 37 Floor joists
- 38 Floorboards
- 39 Water tank
- 40 Hot water tank

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

Single Survey

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

 Structural movement	
Repair category	2
Notes	The property is affected by past settlement evidenced by cracking to the internal and external walls. On the basis of a single inspection this appears to be of a longstanding nature, with no evidence of recent significant movement.

 Dampness, rot and infestation	
Repair category	3
Notes	<p>There are issues with penetrating dampness to the walls, there is evidence of water ingress adjoining some of the windows, and there has been water/damp ingress to the roofs and chimneys. There are issues with significant and fairly extensive decay at both ground and first floor levels, including outbreaks of dry rot, which is affecting timbers including floors, skirtings, wall panelling, door frames, architraves and window frames. Concealed timbers elsewhere in the building may also be affected by rot. Evidence of woodworm infestation was noted to timbers including the roof, floors and joinery. Instruct a reputable firm of timber/damp specialists to carry out a detailed inspection covering the entire property (including exposure works), provide a report and costings prior to purchase and to thereafter undertake all works necessary to a fully documented and guaranteed standard.</p> <p>There are issues with dampness, timber decay and woodworm in the cellar (see below).</p>

 Chimney stacks	
Repair category	2
Notes	There is cracked render and moss growth to the chimneys. There is evidence of penetrating dampness to the chimney breasts.

Single Survey

 Roofing including roof space	
Repair category	2
Notes	<p>The roof coverings are old, there are a number of broken slates and there is evidence of past water/damp ingress in a number of areas. The roof is designed with the rafters and other timbers projecting beyond the wallheads and being exposed externally. Rot is affecting some of these timbers, which is likely to be contributing to problems with dampness and timber decay internally. There is suspect rot to the roof above the lean-to porch/vestibule where there is evidence of water ingress, and the skylight window is affected by corrosion.</p> <p>The roof coverings are of an age and style where ongoing maintenance expenditure should be anticipated, and more extensive overhaul work may be required in the future. Roof coverings must be regularly inspected and maintained to ensure that they remain watertight.</p> <p>In the attic there is evidence of woodworm infestation and some rot to timbers.</p> <p>NOTE: Wasps within the roof voids restricted the extent of the inspection, and not all parts of the roof voids were accessed.</p> <p>It must be confirmed if a guarantee is available for replacing the flat roof over the sun room with fibreglass.</p>
 Rainwater fittings	
Repair category	2
Notes	The cast iron rainwater fittings are affected by corrosion. The rainwater fittings must be properly monitored during heavy rainfall to fully assess their alignment and watertightness.
 Main walls	
Repair category	3
Notes	There is defective render to the external walls. The detailing around the windows requires to be checked as there is evidence of water/damp ingress. There is penetrating dampness to the walls in a number of rooms. There are gaps at the wallhead to the northmost elevation where decayed rafter ends etc have been cut back.

Single Survey

	Windows, external doors and joinery
Repair category	3
Notes	There are gaps around some of the window frames, which is allowing water to enter the fabric of the building. The windows require to be overhauled or replaced. Rot is affecting the roofline joinery timbers. The Velux rooflights are of an older style and should also be replaced.
	External decorations
Repair category	2
Notes	The external paintwork is weathered, and there is flaking paint to the timber joinery finishes.
	Conservatories/porches
Repair category	N/A
Notes	Not applicable.
	Communal areas
Repair category	N/A
Notes	Not applicable.

Single Survey



Garages and permanent outbuildings

Repair category	3
Notes	<p>A timber lintel that spans an opening between the garage/workshop and the attached outbuilding is affected by significant rot, and there is movement to the brickwork above which is unstable, not adequately supported and in danger of collapse. Immediate repairs are required.</p> <p>The older outbuilding has broken, loose and missing slates to the roof, corroded skylight window with broken glazing, defective pointing and plant growth to the walls, water/damp ingress to the walls and roof, decay to timbers including the roof, ceiling joists and external joinery, and defective ceiling plaster.</p> <p>Cladding to the upper walls of the garage/workshop is suspected to contain asbestos. It is generally accepted that asbestos in this form is not hazardous to health unless it becomes damaged or disturbed, or its condition degrades. Specialist advice should be obtained before carrying out any works of repair, maintenance or renewal, and consideration may be given to replacing the fittings. There is rot to the joinery/doors.</p> <p>The garage and the outbuildings are pigeon infested.</p>



Outside areas and boundaries

Repair category	1
Notes	Boundary walls and fences should be regularly checked and maintained as necessary.



Ceilings

Repair category	2
Notes	Cracked and uneven ceiling plaster was noted. Repairs may be required at the time of redecoration or in the event of disturbance. Old lath and plaster can deteriorate in condition and come loose with age, and on occasion it may fail without warning. The ceiling plaster has been patch repaired within the second bathroom.

Single Survey

 Internal walls	
Repair category	3
Notes	<p>There is penetrating dampness to the walls in a number of rooms.</p> <p>Cracked and uneven plaster was noted. Repairs may be required at the time of redecoration or in the event of disturbance. Old lath and plaster can deteriorate in condition and come loose with age, and on occasion it may fail without warning.</p>
 Floors including sub-floors	
Repair category	3
Notes	<p>There is dampness to the floorboards and joists, and there is wet rot and dry rot to timbers.</p>
 Internal joinery and kitchen fittings	
Repair category	2
Notes	<p>The internal joinery is affected by wear and tear.</p>
 Chimney breasts and fireplaces	
Repair category	2
Notes	<p>There is damp ingress to the chimney breasts.</p> <p>The flues that serve the open fires must be swept at least annually, to remove the build-up of soot and to clear out any debris. The condition of the flues must also be checked at this time, and any required repairs attended to. Chimney flues are susceptible to developing defects due to the combined effects of heat, combustion gases and chemical attack.</p> <p>Most of the fireplaces are no longer in use. Ventilating caps should be fitted to the top of the chimneys to prevent rainwater from entering, and to draw air through the flues and maintain them in a dry condition.</p> <p>It is assumed that the AGA has been installed and maintained in accordance with manufacturer's recommendations, particularly regarding fluing and ventilation requirements, and that it has always burned the correct type of fuel. The appliance has not been tested, and is assumed to be in full, safe and efficient working order. The flue must be regularly swept. Copies of the service records must be obtained.</p>

Single Survey

 Internal decorations	
Repair category	2
Notes	The internal decoration requires renewal throughout.
 Cellars	
Repair category	2
Notes	<p>Dampness is evident in the cellar, which is located below ground level with soil retaining walls. Cellars are inherently cold and damp and can be prone to occasional issues with water ingress and/or flooding. Installing vents or a mechanical ventilation system will promote the circulation of air within the cellar, but it may also be necessary to introduce some form of background heating and/or a dehumidifier to effectively reduce moisture levels. Decay and woodworm was noted to joinery timbers. Concealed timbers that have been in contact with damp may also be affected by rot. This requires full and thorough investigation by a timber/damp specialist, and reports and estimates for all works recommended must be obtained before purchase.</p>
 Electricity	
Repair category	2
Notes	<p>Aspects of the electrical installation are on semi modern lines. The system must be checked by a NICEIC/SELECT registered contractor before purchase, and thereafter the installation must be upgraded to meet current regulations.</p> <p>The Institution of Engineering and Technology (IET) recommends that electrical installations are professionally inspected and tested at least every 5 years, and on a change of occupancy. It should be appreciated that only the most recently constructed or rewired properties will have electrical installations that fully comply with IET regulations.</p>
 Gas	
Repair category	N/A
Notes	Not applicable.

Single Survey



Water, plumbing and bathroom fittings

Repair category	2
Notes	<p>The plumbing is generally dated. A reputable contractor must check the entire system and upgrade as necessary. There is no wash hand basin in the upstairs toilet.</p> <p>The property is of an age where lead pipes may be found within the building's internal plumbing or the buried underground water supply, which can be hazardous to health. The cold water rising main was not fully inspectable.</p> <p>Silicone seals and waterproof finishes in bath/shower rooms must be regularly checked and maintained in good order, to ensure that they remain watertight. Concealed plumbing and areas hidden beneath sanitaryware and kitchen units etc cannot be confirmed as being free from defect. It is not unusual for the seepage of water or hidden leaks to only become evident when floor coverings or fittings are removed in kitchens and bathrooms, revealing a need for repair works.</p>



Heating and hot water

Repair category	2
Notes	<p>The boiler is dated, having apparently been installed in 1987, and is likely to require replacement in the very near future. A qualified heating engineer must advise on the remaining life expectancy of the appliance, and provide an estimate for the cost of replacing the boiler and updating the central heating system.</p> <p>Oil fired heating systems must be examined and serviced annually by a qualified engineer, to ensure safe and efficient operation. A copy of the most recent inspection certificate, dated within the past 12 months, must be obtained before purchase. Any observations or recommendations made by the engineer in relation to the heating system or the condition and positioning of the oil storage tank must be noted, as these items may require attention.</p>

Single Survey

 Drainage	
Repair category	1
Notes	<p>It is understood that the property is connected to an exclusive septic tank that is located outwith the site on the opposite side of the A711. It must be confirmed that the private drainage system is registered with the Scottish Environment Protection Agency (SEPA). It is assumed that the septic tank has been regularly emptied and maintained, and documentation relating to this must be obtained. The drainage system was not tested and is assumed to be fully functional. However, the condition of underground drainage pipework can only be properly ascertained by a CCTV survey. No inspection covers have been raised.</p> <p>Where any aspects of the drainage system lie outwith the site boundaries, it must be confirmed that the rights of access for use and maintenance are legally enforceable.</p>

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	2	Category 3
Dampness, rot and infestation	3	Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
Chimney stacks	2	
Roofing including roof space	2	
Rainwater fittings	2	
Main walls	3	
Windows, external doors and joinery	3	Category 2
External decorations	2	Repairs or replacement requiring future attention, but estimates are still advised.
Conservatories/porches	N/A	
Communal areas	N/A	Category 1
Garages and permanent outbuildings	3	No immediate action or repair is needed.
Outside areas and boundaries	1	
Ceilings	2	
Internal walls	3	
Floors including sub-floors	3	
Internal joinery and kitchen fittings	2	
Chimney breasts and fireplaces	2	
Internal decorations	2	
Cellars	2	
Electricity	2	
Gas	N/A	
Water, plumbing and bathroom fittings	2	
Heating and hot water	2	
Drainage	1	

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

Single Survey

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground and First			
2. Are there three steps or fewer to a main entrance door of the property?	Yes	<input checked="" type="checkbox"/>	No	<input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes	<input type="checkbox"/>	No	<input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes	<input type="checkbox"/>	No	<input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes	<input checked="" type="checkbox"/>	No	<input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes	<input checked="" type="checkbox"/>	No	<input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes	<input type="checkbox"/>	No	<input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes	<input checked="" type="checkbox"/>	No	<input type="checkbox"/>

Single Survey

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

- 1) The assumed tenure is Absolute Ownership.
- 2) The road adjoining the property is the A711.
- 3) The property has been altered and extended in the past to provide the present accommodation, although these works are clearly longstanding and historic.
- 4) Details of the extent of the site must be confirmed with the title deeds.
- 5) The septic tank is located outwith the site boundaries. It must be confirmed that the tank is registered with SEPA and that the appropriate servitudes are in place for the use and maintenance of the drainage system.

The buyer is advised to have read this report in its entirety before proceeding with a purchase.

As stated in the Terms and Conditions, the survey is carried out with the permission of the seller and is based on a general surface examination of those parts of the property which are accessible from ground and floor levels. Furniture, stored items and insulation are not moved, and no carpets or floor coverings are lifted. Any parts of the property which cannot be seen or accessed will not be reported upon. With the consent of the seller, more extensive and intrusive types of building inspection can be undertaken, including the use of drones to more closely examine the external fabric. The solicitor/conveyancer should discuss with the prospective purchaser the merits of independently commissioning a more detailed and bespoke survey report, having due regard to the age, character and general condition of the subject property.

Pricing repairs falls outwith the scope of this survey. Accordingly, where defects or items of maintenance or repair have been identified, the buyer must fully satisfy themselves as to the cost and implications of these issues, by obtaining detailed reports and estimates before making a legal commitment to purchase. This will allow an informed decision on whether to proceed with the transaction to be made, and on what terms.

The testing of services falls outwith the scope of this survey. Electrical installations must be professionally tested at least every 5 years, there is a requirement for gas appliances to be examined every 12 months, and most types of central heating system must be serviced on an annual basis to ensure safe and efficient operation. Copies of the most recent test certificates, issued within the relevant date parameters, must be obtained as part of the conveyancing process.

Single Survey

Estimated reinstatement cost for insurance purposes

For Reinstatement Cost Assessment purposes, it is recommended that the subjects be insured for a sum of not less than £1,500,000.

This figure is the estimate of the cost of rebuilding the premises and bears no direct relationship to current market value.

Valuation and market comments

Having considered matters, taking account of our general observations on site, we are of the opinion that the Market Value of the subjects in their present condition and with the benefit of vacant possession may be fairly stated in the sum of £350,000 (THREE HUNDRED AND FIFTY THOUSAND POUNDS STERLING).

Pricing of repairs falls outwith the scope of this survey. It is therefore essential that detailed reports and estimates are obtained to ascertain the cost and extent of the required repairs before making a legal commitment to purchase. In particular, reports are required from a timber and damp specialist, roofing contractor, building contractor and joiner.

The valuation figure assumes that the cost of the Category 3 Repairs will not greatly exceed £40,000. However, should the estimates differ significantly from this provisional allowance all reports and costings must be referred back to the surveyor, as the 'present condition' valuation will have to be reconsidered and may be subject to change.

Signed	<i>Ian Young</i> Electronically signed :- 14/05/2025 11:43
Report author	Ian Young
Company name	J & E Shepherd Chartered Surveyors
Address	18 Castle Street Dumfries DG1 1DR
Date of report	08/05/2025

Mortgage Valuation Report



Property Address

Address Ashton, Tongland, Kirkcudbright, DG6 4LT
Seller's Name Miss Louisa Mansfield (Power of Attorney)
Date of Inspection 08/05/2025

Property Details

Property Type House Bungalow Purpose built maisonette Converted maisonette
 Purpose built flat Converted flat Tenement flat Flat over non-residential use
 Other (specify in General Remarks)

Property Style Detached Semi detached Mid terrace End terrace
 Back to back High rise block Low rise block Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e. g. local authority, military, police? Yes No

Flats/Maisonettes only Floor(s) on which located No. of floors in block Lift provided? Yes No
No. of units in block

Approximate Year of Construction

Tenure

Absolute Ownership Other

Accommodation

Number of Rooms Living room(s) Bedroom(s) Kitchen(s)
 Bathroom(s) WC(s) Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings) m² (Internal) m² (External)

Residential Element (greater than 40%) Yes No

Garage / Parking / Outbuildings

Single garage Double garage Parking space No garage / garage space / parking space
Available on site? Yes No

Permanent outbuildings:

69m² garage/workshop.

Outbuilding with three storage compartments totalling 32m².

Mortgage Valuation Report

Construction

Walls Brick Stone Concrete Timber frame Other (specify in General Remarks)
Roof Tile Slate Asphalt Felt Other (specify in General Remarks)

Special Risks

Has the property suffered structural movement? Yes No

If Yes, is this recent or progressive? Yes No

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity? Yes No

If Yes to any of the above, provide details in General Remarks.

Service Connections

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks

Drainage	<input type="checkbox"/> Mains	<input checked="" type="checkbox"/> Private	<input type="checkbox"/> None	Water	<input checked="" type="checkbox"/> Mains	<input type="checkbox"/> Private	<input type="checkbox"/> None
Electricity	<input checked="" type="checkbox"/> Mains	<input type="checkbox"/> Private	<input type="checkbox"/> None	Gas	<input type="checkbox"/> Mains	<input type="checkbox"/> Private	<input checked="" type="checkbox"/> None
Central Heating	<input checked="" type="checkbox"/> Yes	<input type="checkbox"/> Partial	<input type="checkbox"/> None				

Brief description of Central Heating and any non mains services:

Oil fired boiler to radiators.

Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

Rights of way Shared drives / access Garage or other amenities on separate site Shared service connections
 Ill-defined boundaries Agricultural land included with property Other (specify in General Remarks)

Location

Residential suburb Residential within town / city Mixed residential / commercial Shared service connections
 Commuter village Remote village Isolated rural property Other (specify in General Remarks)

Planning Issues

Has the property been extended / converted / altered? Yes No

If Yes provide details in General Remarks.

Roads

Made up road Unmade road Partly completed new road Pedestrian access only Adopted Unadopted

Mortgage Valuation Report

General Remarks

The property is situated in a rural local adjoining the A711, approximately 2 miles north of Kirkcudbright where the main shopping, social and educational amenities for the area are provided.

There is a large electricity sub-station, associated with the nearby Tongland hydro-electric power station, immediately to the north of the property's garden, but this is more than 80 metres from the house.

At the time of inspection the property was found to be maintained in poor condition having regard to its age and character and is in need of extensive modernisation, refurbishment and repair.

The property is affected by past settlement evidenced by cracking to the internal and external walls. On the basis of a single inspection this appears to be of a longstanding nature, with no evidence of recent significant movement.

In addition to the main accommodation there is a study.

The property has been altered and extended in the past to provide the present accommodation, although these works are clearly longstanding and historic.

Details of the extent of the site must be confirmed with the title deeds.

The septic tank is located outwith the site boundaries. It must be confirmed that the tank is registered with SEPA and that the appropriate servitudes are in place for the use and maintenance of the drainage system.

Essential Repairs

1) Instruct a reputable firm of timber/damp specialists to carry out a detailed inspection covering the entire property (including exposure works), provide a report and costings prior to purchase and to thereafter undertake all works necessary to a fully documented and guaranteed standard. There are issues with penetrating dampness to the walls, there is evidence of water ingress adjoining some of the windows, and there has been water/damp ingress to the roofs and chimneys. There are issues with significant and fairly extensive decay at both ground and first floor levels, including outbreaks of dry rot, which is affecting timbers including floors, skirtings, wall panelling, door frames, architraves and window frames. Concealed timbers elsewhere in the building may also be affected by rot. Evidence of woodworm infestation was noted to timbers including the roof, floors and joinery. There are also issues with dampness, timber decay and woodworm in the cellar.

2) Instruct competent contractors to undertake repairs to the external fabric, to address issues with water and/or damp ingress to the chimneys, roofs, walls and windows.

Pricing of repairs falls outwith the scope of this survey. It is therefore essential that detailed reports and estimates are obtained to ascertain the cost and extent of the required repair works, before making a legal commitment to purchase. In particular, reports are required from a timber and damp specialist, roofer, building contractor and joiner.

The valuation figure assumes that the cost of the Category 3 Repairs will not greatly exceed £40,000. However, should the estimates that are received differ significantly from this provisional allowance, all reports and costings must be referred back to the surveyor, as the valuation will have to be reconsidered and it could be subject to amendment.

Estimated cost of essential repairs

Retention recommended? Yes No

Retention amount

Comment on Mortgageability

The property is unlikely to provide an acceptable security for mortgage loan purposes due to the poor current condition, and the existence of dry rot outbreaks within the building. Consequently, the purchase is open to cash buyers only.

Mortgage Valuation Report

Valuation

Market value in present condition	£ 350,000
Market value on completion of essential repairs	£ 390,000
Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)	£ 1,500,000
Is a reinspection necessary?	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No

Declaration

Signed	<i>Ian Young</i> Electronically signed :- 14/05/2025 11:43
Surveyor's name	Ian Young
Professional qualifications	MRICS
Company name	J & E Shepherd Chartered Surveyors
Address	18 Castle Street, Dumfries, DG1 1DR
Telephone	01387 264333
Email Address	dumfries@shepherd.co.uk
Date of Inspection	08/05/2025



Energy Performance Certificate



Energy Performance Certificate (EPC)

Scotland

Dwellings

ASHTON, TONGLAND, KIRKCUDBRIGHT, DG6 4LT

Dwelling type: Detached house
Date of assessment: 08 May 2025
Date of certificate: 08 May 2025
Total floor area: 303 m²
Primary Energy Indicator: 339 kWh/m²/year


Reference number: 5800-1486-0322-1008-1553
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, oil

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£18,609	See your recommendations report for more information
Over 3 years you could save*	£8,379	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

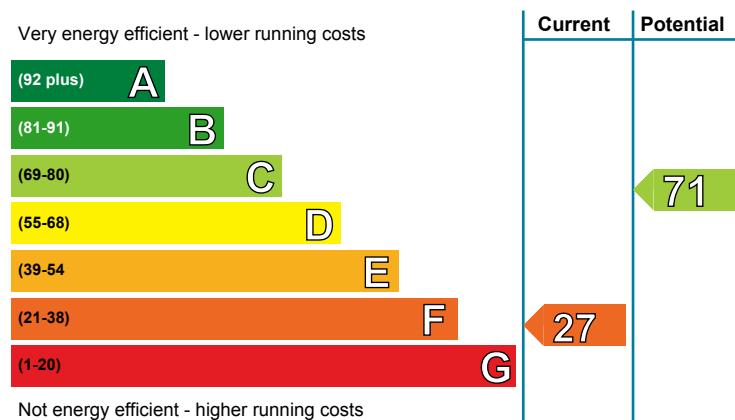


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band F (27)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

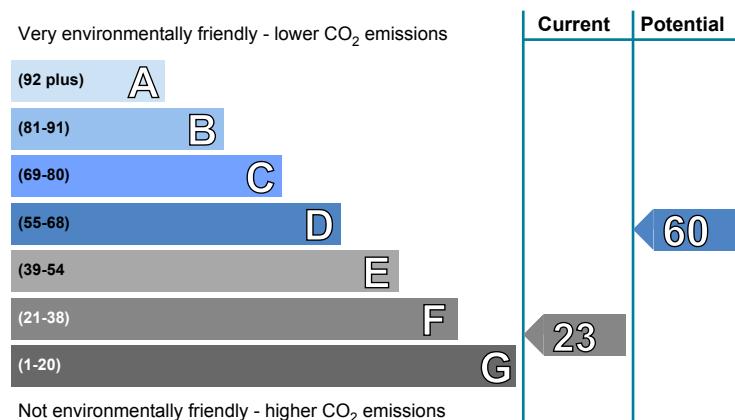

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band F (23)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Increase loft insulation to 270 mm	£100 - £350	£393.00
2 Flat roof or sloping ceiling insulation	£850 - £1,500	£402.00
3 Room-in-roof insulation	£1,500 - £2,700	£1299.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Pitched, 100 mm loft insulation	★★★★☆	★★★★☆
	Roof room(s), no insulation (assumed)	★☆☆☆☆	★☆☆☆☆
Floor	Solid, no insulation (assumed)	—	—
	Suspended, no insulation (assumed)	—	—
Windows	Mostly secondary glazing	★★★★☆	★★★★☆
Main heating	Boiler and radiators, oil	★★☆☆☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★★	★★★★★
Secondary heating	Room heaters, dual fuel (mineral and wood)	—	—
Hot water	From main system	★★☆☆☆	★★☆☆☆
Lighting	Low energy lighting in 70% of fixed outlets	★★★★★	★★★★★

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 88 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 27 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 16 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£16,938 over 3 years	£9,150 over 3 years	
Hot water	£942 over 3 years	£351 over 3 years	
Lighting	£729 over 3 years	£729 over 3 years	
Totals	£18,609	£10,230	 You could save £8,379 over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Increase loft insulation to 270 mm	£100 - £350	£131	F 28	F 24
2 Flat roof or sloping ceiling insulation	£850 - £1,500	£134	F 29	F 25
3 Room-in-roof insulation	£1,500 - £2,700	£433	F 33	F 28
4 Cavity wall insulation	£500 - £1,500	£1079	E 45	F 38
5 Floor insulation (solid floor)	£4,000 - £6,000	£222	E 48	E 40
6 Add additional 80 mm jacket to hot water cylinder	£15 - £30	£27	E 48	E 40
7 Replace boiler with new condensing boiler	£2,200 - £3,000	£704	D 58	E 49
8 Solar water heating	£4,000 - £6,000	£62	D 59	E 50
9 Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£432	D 63	E 53
10 Wind turbine	£15,000 - £25,000	£865	C 71	D 60

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- External insulation with cavity wall insulation
- Air or ground source heat pump

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.



About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Loft insulation

Loft insulation laid in the loft space or between roof rafters to a depth of at least 270 mm will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation should not be placed below any cold water storage tank, any such tank should also be insulated on its sides and top, and there should be boarding on battens over the insulation to provide safe access between the loft hatch and the cold water tank. The insulation can be installed by professional contractors but also by a capable DIY enthusiast. Loose granules may be used instead of insulation quilt; this form of loft insulation can be blown into place and can be useful where access is difficult. The loft space must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about loft insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Flat roof or sloping ceiling insulation

Insulating a flat roof or sloping ceiling will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation can be placed on top of the roof under the waterproof membrane and should particularly be considered when the waterproofing needs to be replaced. Further information about roof insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

3 Room-in-roof insulation

Insulating roof rooms will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. If it has a flat ceiling insulation can usually be added above the ceiling, and sloping ceilings and walls of roof rooms can be insulated using an internal lining board. Roof voids must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about roof room insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). Building regulations generally apply to this work so it is best to check this with your local authority building standards department.

4 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

5 Floor insulation (solid floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulating solid floors can present challenges; insulation laid on top of existing solid floors may impact on existing doors and finishes whilst lifting of a solid floor to insert insulation below will require consideration of the potential effect on both structural stability and damp proofing. It is advised to seek advice from a Chartered Structural Engineer or a registered Architect about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work and may also require a building warrant so it is best to check with your local authority building standards department.

6 Hot water cylinder insulation

Increasing the thickness of existing insulation by adding an 80 mm cylinder jacket around the hot water cylinder will help maintain the water at the required temperature; this will reduce the amount of energy used and lower fuel bills. The jacket should be fitted over the top of the existing foam insulation and over any thermostat clamped to the cylinder. Hot water pipes from the hot water cylinder should also be insulated, using pre-formed pipe insulation of up to 50 mm thickness, or to suit the space available, for as far as they can be accessed to reduce losses in summer. All these materials can be purchased from DIY stores and installed by a competent DIY enthusiast.

7 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

8 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

9 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

10 Wind turbine

A wind turbine provides electricity from wind energy. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Wind turbines are not suitable for all properties. The system's effectiveness depends on local wind speeds and the presence of nearby obstructions, and a site survey should be undertaken by an accredited installer. Planning permission might be required and building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for a wind turbine, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	54,330	(1,277)	(9,991)	N/A
Water heating (kWh per year)	3,453			

Addendum

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Ian Young
Assessor membership number:	EES/012603
Company name/trading name:	J & E Shepherd
Address:	13 Albert Square Dundee DD1 1XA
Phone number:	01382 200454
Email address:	dundee@shepherd.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT





Property Questionnaire



property questionnaire

Property address	Ashton Tongland Kirkcudbright DG6 4LT
Seller(s)	Miss Louise Mansefield (Power of Attorney)
Completion date of property questionnaire	

property questionnaire

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership	
	How long have you owned the property? 1997 = 28 yrs	
2.	Council tax	
	Which Council Tax band is your property in? G	
3.	Parking	
	What are the arrangements for parking at your property? (Please tick all that apply)	
	<ul style="list-style-type: none">• Garage• Allocated parking space• Driveway• Shared parking• On street• Resident permit• Metered Parking• Other (please specify):	<input type="checkbox"/> <input type="checkbox"/> <input checked="" type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/>
4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	NO

property questionnaire

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	X
6.	Alterations/additions/extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? <u>If you have answered yes, please describe below the changes which you have made:</u>	NO
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? <u>If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</u>	
	<u>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:</u>	
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property? <u>If you have answered yes, please answer the three questions below:</u>	NO
	(i) Were the replacements the same shape and type as the ones you replaced?	
	(ii) Did this work involve any changes to the window or door openings?	
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed): <u>Please give any guarantees which you received for this work to your solicitor or estate agent.</u>	
	7.	Central heating
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom). <u>If you have answered yes or partial – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</u>	YES OIL

property questionnaire

<p><u>If you have answered yes, please answer the three questions below:</u></p> <p>i) When was your central heating system or partial central heating system installed? Unknown</p> <p>ii) Do you have a maintenance contract for the central heating system? <u>If you have answered yes, please give details of the company with which you have a maintenance contract:</u> NO</p> <p>iii) When was your maintenance agreement last renewed? (Please provide the month and year).</p>																							
8.	Energy Performance Certificate																						
	Does your property have an Energy Performance Certificate which is less than 10 years old?	NO																					
9.	Issues that may have affected your property																						
a.	Has there been any storm, flood, fire or other structural damage to the property while you have owned it? <u>If you have answered yes, is the damage the subject of any outstanding insurance claim?</u>	NO																					
b.	Are you aware of the existence of asbestos in your property? <u>If you have answered yes, please give details:</u>	NO																					
10.	Services																						
a.	Please tick which services are connected to your property and give details of the supplier:																						
<table border="1"> <thead> <tr> <th>Services</th> <th>Connected</th> <th>Supplier</th> </tr> </thead> <tbody> <tr> <td>Gas or liquid petroleum gas</td> <td>NO</td> <td></td> </tr> <tr> <td>Water mains or private water supply</td> <td>YES</td> <td>Scottish Water</td> </tr> <tr> <td>Electricity</td> <td>YES</td> <td>Scottish Power</td> </tr> <tr> <td>Mains drainage</td> <td>NEEDS NO</td> <td>Septic tank</td> </tr> <tr> <td>Telephone</td> <td>YES</td> <td>BT</td> </tr> <tr> <td>Cable TV or satellite</td> <td>NO</td> <td></td> </tr> </tbody> </table>			Services	Connected	Supplier	Gas or liquid petroleum gas	NO		Water mains or private water supply	YES	Scottish Water	Electricity	YES	Scottish Power	Mains drainage	NEEDS NO	Septic tank	Telephone	YES	BT	Cable TV or satellite	NO	
Services	Connected	Supplier																					
Gas or liquid petroleum gas	NO																						
Water mains or private water supply	YES	Scottish Water																					
Electricity	YES	Scottish Power																					
Mains drainage	NEEDS NO	Septic tank																					
Telephone	YES	BT																					
Cable TV or satellite	NO																						

property questionnaire

	Broadband		
b.	<p>Is there a septic tank system at your property?</p> <p><u>If you have answered yes, please answer the two questions below:</u></p> <p>(i) Do you have appropriate consents for the discharge from your septic tank?</p> <p>(ii) Do you have a maintenance contract for your septic tank?</p> <p><u>If have answered yes, details of the company with which you have a maintenance contract:</u></p>	YES	
11.	<p>Responsibilities for shared or common areas</p> <p>a. Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?</p> <p><u>If you have answered yes, please give details:</u></p>		
b.	<p>Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?</p> <p><u>If you have answered yes, please give details:</u></p>		
c.	<p>Has there been any major repair or replacement of any part of the roof during the time you have owned the property?</p>		
d.	<p>Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?</p> <p><u>If you have answered yes, please give details:</u></p>		
e.	<p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p><u>If you have answered yes, please give details:</u></p>		
f.	<p>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)</p> <p><u>If you have answered yes, please give details:</u></p>		
12.	<p>Charges associated with the property</p>		
a.	<p>Is there a factor or property manager for your property?</p>		

property questionnaire

	<p><u>If you have answered yes</u>, please provide the name and address, and give details of any deposit held and approximate charges:</p>	
b.	<p>Is there a common buildings insurance policy? <u>If you have answered yes</u>, is the cost of the insurance included in monthly/annual factor's charges?</p>	NO
c.	<p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p>	
13.	<p>Specialist work</p>	
a.	<p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? <u>If you have answered yes</u>, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.</p>	NO
b.	<p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? <u>If you have answered yes</u>, please give details:</p>	NO
c.	<p>If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work? <u>If you have answered yes</u>, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself <u>please write below who has these documents</u> and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p>	
14.	<p>Guarantees</p>	
a.	<p>Are there any guarantees or warranties for any of the following?</p>	
	(i) Electrical work	NO
	(ii) Roofing	NO
	(iii) Central heating	NO
	(iv) National House Building Council (NHBC)	NO
	(v) Damp course	NO
	(vi) Any other work installations? (for example, cavity wall installation, underpinning, indemnity policy)	NO

property questionnaire

b.	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):	
c.	Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details:	NO
15.	Boundaries	
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	NO
	If you have answered yes, please give details:	
16.	Notices that affect your property	
	In the past three years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	NO
b.	that affects your property in some other way?	NO
c.	that requires you to do any maintenance, repairs or improvements to your property?	NO
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief


Name(s):

Louise Mansfield

Date:

08.05.25



-  [Home Report](#)
-  [Valuation Report](#)
-  [Executory Valuation](#)
-  [Tax Valuations](#)
-  [Separation Valuation](#)
-  [Private Sale Valuation](#)
-  [New Build & Plot Valuation](#)
-  [Insurance Reinstatement Valuation](#)
-  [Portfolio Valuation](#)
-  [Rental Valuation](#)
-  [Drive By & Desktop Valuation](#)
-  [Energy Performance Certificate \(EPC\)](#)
-  [Level Two Survey & Valuation Report](#)
-  [Level Two Condition Report](#)
-  [Expert Witness Report](#)

-  [Commercial Valuation](#)
-  [Commercial Agency](#)
-  [Acquisitions Consultancy](#)
-  [Commercial Lease Advisory](#)
-  [Rent Reviews](#)
-  [Asset Management](#)
-  [Development Appraisals & Consultancy](#)
-  [Auctions](#)
-  [Property Management](#)
-  [Professional Services](#)
-  [Licensed Trade & Leisure](#)
-  [Expert Witness Report](#)
-  [Rating](#)
-  [Property Investment](#)
-  [Public Sector](#)

-  [Quantity Surveying](#)
-  [Building Surveying](#)
-  [Project Management](#)
-  [Dispute Resolution Support Services](#)
-  [Principal Designer](#)
-  [Clerk of Works](#)
-  [Commercial EPC](#)
-  [Health & Safety Management](#)
-  [Employer's Agent](#)
-  [Energy Consultancy](#)
-  [Housing Partnerships](#)
-  [Housing Consultancy](#)
-  [Development Monitoring](#)
-  [Mediation Services](#)

Aberdeen △▲△ 01224 202800	Dalkeith △▲ 0131 663 2780	Edinburgh △▲ 0131 2251234 △ 0131 557 9300	Glasgow West End △▲ 0141 353 2080	Leeds △ 0113 322 5069	Perth △▲ 01738 638188 △ 01738 631631
Ayr △▲ 01292 267987	Dumbarton △▲ 01389 731682	Elgin △▲ 01343 553939	Greenock △▲ 01475 730717	Livingston △▲ 01506 416777	Peterhead △▲ 01779 470766
Bearskens △▲ 0141 611 1500	Dumfries △▲△ 01387 264333	Falkirk △▲ 01324 635 999	Hamilton △▲ 01698 891400	London △▲ 02033 761 236	St Andrews △▲ 01334 477773 △ 01334 476469
Belfast △ 02890 912975	Dundee △▲ 01382 200454 △ 01382 220699	Fraserburgh △▲ 01346 517456	Inverness △▲△ 01463 712239	Montrose △▲ 01674 676768	Saltcoats △▲ 01294 464228
Birmingham △ 0121 270 2266	Dunfermline △▲ 01383 722337 △ 01383 731841	Galashiels △▲ 01896 750150	Kilmarnock △▲ 01563 520318	Musselburgh △▲ 0131 653 3456	Stirling △▲ 01786 450438 △ 01786 474476
Coatbridge △▲ 01236 436561	East Kilbride △▲ 01355 229317	Glasgow △▲△ 0141 331 2807	Kirkcaldy △▲ 01592 205442	Oban △▲ 01631 707 800	Paisley △▲ 0141 889 8334
Cumbernauld △▲ 01236 780000		Glasgow South △▲ 0141 649 8020	Lanark △▲ 01555 663058		