

P A R T 1 .

SINGLE SURVEY

A report on the condition of the property, with categories being rated from 1 to 3.



Survey report on:

Surveyor Reference	AE/5793
Customer	Mr. Graeme Cowan
Selling address	4 Burnbank Place Ayr KA7 3QQ
Date of Inspection	01/09/2026
Prepared by	Kevin Hay, BSc MRICS Ayr - Allied Surveyors Scotland Ltd

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The subject property comprises a semi detached house, two storeys in height.
Accommodation	Ground floor - entrance hallway, living room and kitchen. First floor - three bedrooms and bathroom with WC.
Gross internal floor area (m2)	80 square metres.
Neighbourhood and location	The property is located in the Belmont District of Ayr. It is well located in relation to local facilities and amenities.
Age	Approximately 64 years.
Weather	Overcast and dry.
Chimney stacks	The chimney stack has been removed and has been replaced with a metal flue. Visually inspected with the aid of binoculars where required.


Roofing including roof space	The roof is pitched, timber framed, boarded with timber sarking and overlaid with concrete tiles. Sloping roofs were visually inspected with the aid of binoculars where required. Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Flat roofs have a limited life and depending on their age and quality of workmanship can fail at any time. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.
Rainwater fittings	Gutters and downpipes are of PVC. Visually inspected with the aid of binoculars where required.
Main walls	The outer walls are of cavity brick construction, rendered externally. Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected.
Windows, external doors and joinery	The windows are of UPVC framed double glazed replacement type. Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open.
External decorations	UPVC fascias at eaves level. Visually inspected.
Conservatories / porches	Not applicable. Visually inspected.
Communal areas	None apparent.
Garages and permanent outbuildings	There is an attached integral brick store at the side of the property. Visually inspected.

Outside areas and boundaries	There is a block paved driveway at the front. The garden grounds are also laid to grass, decorative gravel and slabs. The boundaries are enclosed in timber fencing and brick walls. Visually inspected.
Ceilings	The ceilings are of plasterboard. Visually inspected from floor level.
Internal walls	Internal walls are plastered on the hard or plasterboard lined. Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
Floors including sub floors	Floors are of suspended timber construction laid off timber joists. Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.
Internal joinery and kitchen fittings	The kitchen is fitted with a stainless steel sink unit and modern floor and wall units. There are modern internal white doors with chrome handles. Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances.
Chimney breasts and fireplaces	The living room houses a modern living flame pebble effect gas fire. Visually inspected. No testing of the flues or fittings was carried out.
Internal decorations	The internal walls have a predominantly painted finish. Visually inspected.
Cellars	Not applicable.

Electricity	Mains connected. Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.
Gas	Mains connected. Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.
Water, plumbing and bathroom fittings	Mains connected. The shower room comprises a WC, wash hand basin and shower cubicle. Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances.
Heating and hot water	Gas fired central heating system with radiators. Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances.
Drainage	Mains connected. Drainage covers etc were not lifted. Neither drains nor drainage systems were tested.

Fire, smoke and burglar alarms	There are smoke, heat and carbon monoxide alarms in the property. Visually inspected. No test whatsoever were carried out to any systems or appliances. There is now a requirement in place for compliant interlinked fire, smoke and heat detectors in residential properties. The new fire smoke and alarm standard came into force in Scotland in February 2022, requiring a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also requires to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon fuelled appliance such as a boiler, open fire or wood burner etc. a carbon monoxide detector is also required. The surveyor will only comment on the presence of a smoke detector etc. but will not test them, ascertain if they are in working order, interlinked and / or fully compliant with the fire and smoke alarm standard that was introduced in 2022. We have for the purposes of the report, assumed the system is fully compliant, if not then the appropriate compliant system will required to be installed prior to sale. This of course should be confirmed by your legal advisor.
Any additional limits to inspection	At the time of the inspection, the property was unoccupied and unfurnished although fitted floor coverings were noted throughout. It was inspected externally and internally from ground/floor level. A limited "head and shoulders" inspection of the roof void was carried out via a loft hatch in the ceiling of the first floor landing. No sub floor inspection was undertaken. An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.

Sectional Diagram showing elements of a typical house

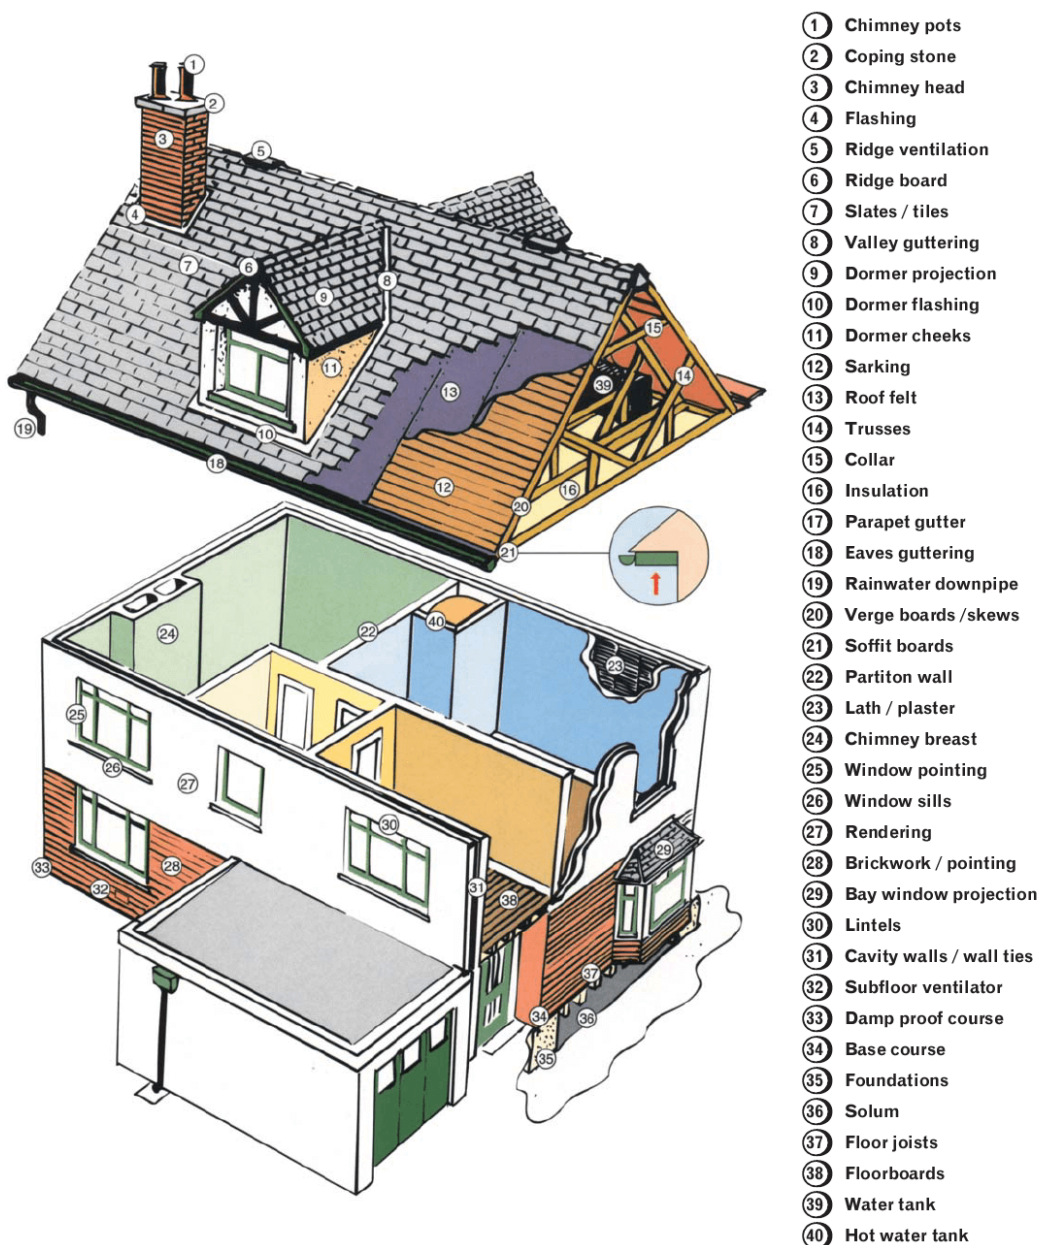

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the above 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category:	1
Notes:	There is evidence of past movement seen in the form of cracking at the external rendering. The movement appears longstanding and there is no obvious evidence of recent deterioration.

Dampness, rot and infestation	
Repair category:	1
Notes:	No signs of any significant dampness, rot or infestation were noted during our limited inspection of the property.

Chimney stacks	
Repair category:	1
Notes:	The chimney stack has been removed and has been replaced with a metal flue. Flues in use should be checked as a matter of routine.

Roofing including roof space	
Repair category:	2
Notes:	The roof covering is the original and is showing signs of general weathering. Moss growth was noted at roof tiles. Cracked cement pointing was noted at the edges of the roof tiles at the gable end of the building. The roof covering will require ongoing maintenance to preserve its effectiveness.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Rainwater fittings	
Repair category:	1
Notes:	The rainwater goods are modern.

Main walls	
Repair category:	2
Notes:	Cracked and missing render at the external walls should be cut back and repaired as required. The cost of render repairs should be budgeted for. Cavity wall insulation has been introduced. It is therefore essential that the external walls are maintained in a wind and water tight condition.

Windows, external doors and joinery	
Repair category:	2
Notes:	Most of the windows are of an older style and show signs of general wear at operating mechanisms and handles. Some of the mechanisms are also worn/damaged. The windows would benefit from being upgraded. There is however a more modern double glazed window unit at the kitchen. The front and rear doors are modern.

External decorations	
Repair category:	1
Notes:	The external appearance of the property is satisfactory.

Conservatories / porches	
Repair category:	
Notes:	None.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Communal areas	
Repair category:	
Notes:	None.

Garages and permanent outbuildings	
Repair category:	1
Notes:	The integral brick store was full of stored items at the date of inspection.

Outside areas and boundaries	
Repair category:	1
Notes:	The garden grounds have recently been landscaped. They are well laid out and maintained. General wear was however noted at boundary brick walls at the rear.

Ceilings	
Repair category:	1
Notes:	No significant defects were noted at plasterboard lined ceilings.

Internal walls	
Repair category:	1
Notes:	No significant defects were noted at internal walls although some loose wall plaster was noted at the wall adjacent to the under sink unit in the kitchen. This should be replastered as required.

Floors including sub-floors	
Repair category:	1
Notes:	No significant defects were noted at internal floors. There are modern floor coverings throughout.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Internal joinery and kitchen fittings

Repair category:	1
Notes:	The kitchen units and internal doors have recently been replaced and are in good general condition.

Chimney breasts and fireplaces

Repair category:	1
Notes:	It is understood that the modern gas fire in the living room has recently been fitted. Flues in use should be checked as a matter of routine particularly where gas appliances are involved. The current test certificate should be exhibited. Moisture meter tests at chimney breasts revealed no evidence of significant dampness at the points of examination.

Internal decorations

Repair category:	1
Notes:	The property has recently been painted throughout.

Cellars

Repair category:	
Notes:	None.

Electricity

Repair category:	1
Notes:	The electrical switch gear is wall mounted in the hall cupboard. There are circuit breakers. No tests of the electrics were undertaken. The current electrical test certificate should be exhibited.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Gas

Repair category:

1

Notes:

The gas meter box is located at the front elevation.

Water, plumbing and bathroom fittings

Repair category:

1

Notes:

The shower room fitments have recently been installed and are in good condition.

Heating and hot water

Repair category:

1

Notes:

The Worcester Greenstar 8000 Life central heating boiler is housed in the bedroom cupboard. It is served by a balanced flue. It is understood to be approximately 5 years of age although will require ongoing maintenance/annual servicing to remain effective. The current test certification should be exhibited.

Drainage

Repair category:

1

Notes:

Drainage is by gravity feed to the Local Authority sewer. Drainage covers were not lifted nor were any tests undertaken on the system.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	1
Roofing including roof space	2
Rainwater fittings	1
Main walls	2
Windows, external doors and joinery	2
External decorations	1
Conservatories / porches	
Communal areas	
Garages and permanent outbuildings	1
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	Ground & First
2. Are there three steps or fewer to a main entrance door of the property?	☐ YES ☒ NO
3. Is there a lift to the main entrance door of the property?	☐ YES ☒ NO
4. Are all door openings greater than 750mm?	☐ YES ☒ NO
5. Is there a toilet on the same level as the living room and kitchen?	☐ YES ☒ NO
6. Is there a toilet on the same level as a bedroom?	☒ YES ☐ NO
7. Are all rooms on the same level with no internal steps or stairs?	☐ YES ☒ NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	☒ YES ☐ NO

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer	
It is assumed that the property and its value are unaffected by any matters which would or should be revealed to a completing Solicitor by a local search/replies to usual enquiries or by any statutory notice or planning proposal. Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.	
Estimated re-instatement cost (£) for insurance purposes	
240,000 Two Hundred and Forty Thousand Pounds	
Valuation (£) and market comments	
155,000 Following a return in confidence to the market, properties are now generally selling well providing mortgage finance remains available and they are realistically priced. We value the property vacant and in its present condition at the capital sum of One Hundred and Fifty Five Thousand Pounds.	
Report author:	Kevin Hay, BSc MRICS
Company name:	Ayr - Allied Surveyors Scotland Ltd
Address:	3 Alloway Street Ayr KA7 1SP
Signed:	Electronically Signed: 322524-3e05d2d5-ca31
Date of report:	01/09/2026

P A R T 2 .

MORTGAGE VALUATION REPORT

Includes a market valuation of the property.



Mortgage Valuation Report

Mortgage Valuation Report

Property:	4 Burnbank Place Ayr KA7 3QQ	Client: Mr. Graeme Cowan Tenure: Ownership
Date of Inspection:	01/09/2026	Reference: AE/5793

This report has been prepared as part of the seller's instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising a potential lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.

1.0 LOCATION

The property is located in the Belmont District of Ayr. It is well located in relation to local facilities and amenities.

2.0 DESCRIPTION	2.1 Age:	Approximately 64 years.
-----------------	----------	-------------------------

The subject property comprises a semi detached house, two storeys in height.

3.0 CONSTRUCTION

Walls - cavity brick construction, rendered externally.

Roof - pitched and tiled.

4.0 ACCOMMODATION

Ground floor - entrance hallway, living room and kitchen.

First floor - three bedrooms and bathroom with WC.

5.0 SERVICES (No tests have been applied to any of the services)

Water:	Mains	Electricity:	Mains	Gas:	Mains	Drainage:	Mains
--------	-------	--------------	-------	------	-------	-----------	-------

Central Heating:	Gas fired with radiators
------------------	--------------------------

6.0 OUTBUILDINGS

Garage:	Off street car parking.
---------	-------------------------

Others:	Integral brick store at the side.
---------	-----------------------------------

7.0	GENERAL CONDITION - A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.
-----	---

The property has recently been modernised and upgraded. It has new kitchen and shower room fittings.					
The roof covering is the original and will require ongoing maintenance.					
Cracked and missing render at the external walls should be repaired as required.					
The windows are of an older style and show signs of general wear at operating mechanisms and handles.					
There is evidence of past movement seen in the form of cracking at the external rendering. The movement appears longstanding and there is no obvious evidence of recent deterioration.					
8.0	ESSENTIAL REPAIR WORK (as a condition of any mortgage or, to preserve the condition of the property)				
None apparent.					
8.1 Retention recommended:			n/a		
9.0	ROADS & FOOTPATHS				
Made up.					
10.0	BUILDINGS INSURANCE (£):	240,000	GROSS EXTERNAL FLOOR AREA	94	Square metres
	This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.				
11.0	GENERAL REMARKS				
Situating within an area where there is currently a reasonable demand for this style of accommodation, the property represents a suitable security for mortgage lending purposes.					
It is assumed that the property and its value are unaffected by any matters which would or should be revealed to a completing Solicitor by a local search/replies to usual enquiries or by any statutory notice or planning proposal.					
Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.					
12.0	VALUATION On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.				
12.1	Market Value in present condition (£):	155,000	Following a return in confidence to the market, properties are now generally selling well providing mortgage finance remains available and they are realistically priced. We value the property vacant and in its present condition at the capital sum of One Hundred and Fifty Five Thousand Pounds		
12.2	Market Value on completion of essential works (£):	n/a			
12.3	Suitable security for normal mortgage purposes?	Yes			
12.4	Date of Valuation:	01/09/2026			
Signature:		Electronically Signed: 322524-3e05d2d5-ca31			

Surveyor:	Kevin Hay	BSc MRICS	Date:	01/09/2026
Ayr - Allied Surveyors Scotland Ltd				
Office:	3 Alloway Street Ayr KA7 1SP	Tel: 01292 260 509 Fax: email: ayr@alliedsurveyorsscotland.com		

P A R T 3 .

ENERGY REPORT

A report on the energy efficiency of the property.



energy report

energy report on:

Property address	4 Burnbank Place Ayr KA7 3QQ
-------------------------	------------------------------------

Customer	Mr. Graeme Cowan
-----------------	------------------

Customer address	4 Burnbank Place Ayr KA7 3QQ
-------------------------	------------------------------------

Prepared by	Kevin Hay, BSc MRICS Ayr - Allied Surveyors Scotland Ltd
--------------------	---

Energy Performance Certificate (EPC)

Scotland

Dwellings

4 BURNBANK PLACE, AYR, KA7 3QQ

Dwelling type: Semi-detached house
Date of assessment: 01 September 2026
Date of certificate: 02 September 2026
Total floor area: 80 m²
Primary Energy Indicator: 189 kWh/m²/year

Reference number: 0192-1046-7231-6886-2220
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas


You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£3,456	See your recommendations report for more information
Over 3 years you could save*	£264	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Very energy efficient - lower running costs

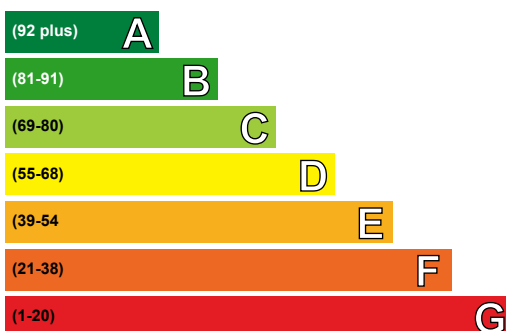

Not energy efficient - higher running costs

Current	Potential
69	77


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (69)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Very environmentally friendly - lower CO₂ emissions

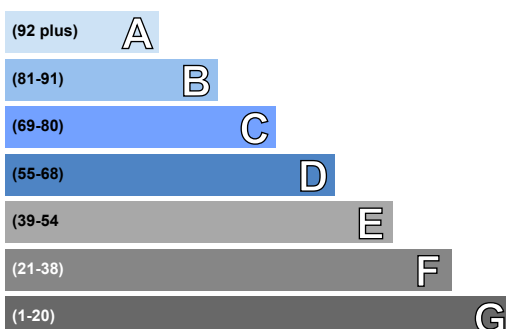

Not environmentally friendly - higher CO₂ emissions

Current	Potential
73	77

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band C (73)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Floor insulation (suspended floor)	£5,000 - £10,000	£264.00
2 Solar photovoltaic (PV) panels	£8,000 - £10,000	£630.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction. See the addendum section on the last page of this report for further information relating to items in the table.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, filled cavity	★★★★☆	★★★★☆
Roof	Pitched, 300 mm loft insulation	★★★★★	★★★★★
Floor	Suspended, no insulation (assumed)	—	—
Windows	Fully double glazed	★★☆☆☆	★★☆☆☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	Room heaters, mains gas	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Excellent lighting efficiency	★★★★★	★★★★★

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 33 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 2.6 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.4 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£2,493 over 3 years	£2,229 over 3 years	
Hot water	£813 over 3 years	£813 over 3 years	
Lighting	£150 over 3 years	£150 over 3 years	
Totals	£3,456	£3,192	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Floor insulation (suspended floor)	£5,000 - £10,000	£88		
2 Solar photovoltaic panels, 2.5 kWp	£8,000 - £10,000	£210		

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

2 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	9,106.3	N/A	N/A	N/A
Water heating (kWh per year)	1,771.32			

Addendum

When considering the PV installation consider installing PV battery and a PV diverter for water heating

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Kevin Hay
Assessor membership number:	EES/008225
Company name/trading name:	Allied Surveyors Scotland Ltd
Address:	3 Alloway Street Ayr KA7 1SP
Phone number:	01292 260509
Email address:	ayr@alliedsurveyorsscotland.com
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greenerscotland.org](https://www.greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



P A R T 4 .

PROPERTY QUESTIONNAIRE

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.



Property Questionnaire

Property Address

4 Burnbank Place

Ayr

KA7 3QQ

Seller(s)

Graeme Cowan

Completion date of property questionnaire

31/08/2026

Note for sellers

1.	Length of ownership
	How long have you owned the property? 30 years
2.	Council tax
	Which Council Tax band is your property in? (Please circle) ☐ A ☐ B ☒ C ☐ D ☐ E ☐ F ☐ G ☐ H
3.	Parking
	What are the arrangements for parking at your property? (Please tick all that apply) Garage ☐ Allocated parking space ☐ Driveway ☒ Shared parking ☐ On street ☐ Resident permit ☐ Metered parking ☐ Other (please specify):

4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	☐ YES ☒ NO ☐ Don't know
5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	☐ YES ☒ NO
6.	Alterations/additions/extensions	
a	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	☐ YES ☒ NO
	If you have answered yes, please describe below the changes which you have made:	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	☐ YES ☐ NO
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b	Have you had replacement windows, doors, patio doors or double glazing installed in your property	☒ YES ☐ NO
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	☐ YES ☒ NO
	(ii) Did this work involve any changes to the window or door openings?	☐ YES ☒ NO
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed): <i>New front and side doors installed 2026.</i> Please give any guarantees which you received for this work to your solicitor or estate agent.	
7.	Central heating	
a	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	☒ YES ☐ NO ☐ Partial

property questionnaire

	If you have answered yes or partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). <i>Gas fired</i>	
	If you have answered yes, please answer the three questions below:	
	(i) When was your central heating system or partial central heating system installed? <i>New boiler 2021</i>	
	(ii) Do you have a maintenance contract for the central heating system?	☒ YES ☐ NO
	If you have answered yes, please give details of the company with which you have a maintenance contract <i>O'neil gas services</i>	
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year). <i>2026</i>	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	☒ YES ☐ NO
9.	Issues that may have affected your property	
a	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	☐ YES ☒ NO
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	☐ YES ☐ NO
b	Are you aware of the existence of asbestos in your property?	☐ YES ☒ NO ☐ Don't know
	If you have answered yes, please give details:	
10.	Services	

property questionnaire

a	Please tick which services are connected to your property and give details of the supplier:		
	Services	Connected	Supplier
	Gas or liquid petroleum gas	Y	Octopus
	Water mains or private water supply	Y	Scottish water
	Electricity	Y	Octopus
	Mains drainage	Y	Scottish water
	Telephone	N	
	Cable TV or satellite	N	
	Broadband	N	
b	Is there a septic tank system at your property?		[] YES [x] NO
	If you have answered yes, please answer the two questions below:		
	(i) Do you have appropriate consents for the discharge from your septic tank?	[] YES [] NO [] Don't know	
	(ii) Do you have a maintenance contract for your septic tank?	[] YES [] NO	
	If you have answered yes, please give details of the company with which you have a maintenance contract:		
11.	Responsibilities for shared or common areas		
a	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details: <i>Quarterly summary from Ayrshire Housing for grass cutting.</i>		[x] YES [] NO [] Don't know
b	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:		[] YES [x] NO [] N/A
c	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?		[] YES [x] NO
d	Do you have the right to walk over any of your neighbours' property- for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details:		[] YES [x] NO

property questionnaire

e	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:	☐ YES ☒ NO
f	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.) If you have answered yes, please give details:	☐ YES ☒ NO
12. Charges associated with your property		
a	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	☐ YES ☒ NO
b	Is there a common buildings insurance policy?	☐ YES ☒ NO ☐ Don't know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factors charges?	
c	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
13. Specialist works		
a	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	☐ YES ☒ NO
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	
b	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	☐ YES ☒ NO
	If you have answered yes, please give details:	
c	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	☐ YES ☐ NO
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	

14.	Guarantees	
a	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
(ii)	Roofing	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
(iii)	Central heating	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
(iv)	National House Building Council(NHBC)	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
(v)	Damp course	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	☒ NO ☐ YES ☐ Don't know ☐ With title deeds ☐ Lost
b	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):	
c	Are there any outstanding claims under any of the guarantees listed above?	☐ YES ☒ NO
	If you have answered yes, please give details:	

15.	Boundaries	
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	☐ YES ☒ NO ☐ Don't know
	If you have answered yes, please give details:	
16.	Notices that affect your property	
In the past three years have you ever received a notice:		
a	advising that the owner of a neighbouring property has made a planning application?	☐ YES ☒ NO
b	that affects your property in some other way?	☐ YES ☒ NO
c	that requires you to do any maintenance, repairs or improvements to your property?	☐ YES ☒ NO
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s):	Graeme Cowan
Capacity:	[x]Owner []Legally Appointed Agent for Owner
Date:	31/08/2026